Lift / Equipment Maintenance Report

Lift /	Equipment ID		Job Refe	erence	Date	
ODE	0 - 1147/2003		SC3001	31	15/05/2025	
Site A	Address		Contract	Туре		
	LABURNUM HOUSE		Standa	rd		
	DWELLAVENUE ENHAM RM10		Custome	er Reference		
7AE		Inspec	ted By			
			Steve Tu	utt		
Mai	ntenance Checks	Serviceable	Worn but Serviceable	Requires Attention	Should be Renewed	N/A
1.	Guide Rails and Fixings		✓			
2.	Buffers		✓			
3.	Reduction Gear				\checkmark	
4.	O/H Diverter Sheaves			\checkmark		
5	Traction Sheave				1	

1.	Guide Rails and Fixings	√			
2.	Buffers	✓			
3.	Reduction Gear			\checkmark	
4.	O/H Diverter Sheaves		\checkmark		
5.	Traction Sheave			\checkmark	
6.	Brake	✓			
7.	Motor			\checkmark	
8.	Control Panel			\checkmark	
9.	Floor Selector			\checkmark	
10.	Shaft Switches			√	
11.	Overtravel Limits	✓			
12.	Main Ropes	✓			
13.	Ropes – Safety / Governor	✓			
14.	Governor	✓			
15.	Idle Pulley				\checkmark
16.	Guide Shoes (Car & B/Wt)		\checkmark		
17.	Car Enclosure	✓			
18.	Car Light	✓			
19.	Car Top Control			√	
20.	Safety Gear	✓			
21.	Fire Control Switch	✓			
22.	Vision Panels	✓			
23.	Car / Landing Doors & Gates		\checkmark		
24.	Door Operator			√	
25.	Locks (inc. Emergency Release)			√	
26.	Safety Edges	✓			
27.	Moving Ramps				\checkmark
28.	Pushes – Car / Landing	✓			
29.	Indicators and Signals			√	
30.	Main Switch and CB	✓			
31.	Shaft and Motor Room Wiring	✓			
32.	Shaft Lighting	✓			
33.	Flexes and Junction Boxes	✓			
34.	Alarm System	✓			

35.	Emergency Lighting (inc. Motor Room)		\checkmark	

36.	Lift Monitoring System (last recorded event)		
37.	Date of Car Light Replacement		Next Visit Due By:
38.	Handwinding Equipment Functioning Correctly	No	29/06/2025
39.	Emergency Communication Systems Test (Date)		29/00/2025

Powered by Motivity Mobile Workforce Software | www.motivitymobile.com

Motor Room Access	: Yes	Lift Motor Room Lighting	j: Yes	Controller Mat:	Yes	Machine Guards:	Yes
Warning Notices -		Electric Shock:	Yes	Hand Wind:	Yes	Lift Machinery:	Yes
Intershaft Screens:	No	Toe Guard:	Yes	Shaft Facings:	Yes	Car Top Guard:	Yes
Pit Ladder:	N/A	If required – state depth	:			Pit Guards:	Yes
Items under Obse	ervatior	1					
1-drop down type fire co 2-main ropes showing si 3-fire extinguisher in m/r	igns of wea						
1-complete overhaul reco	ommende	d due to age and corrosion (6809) TVC 200	3)			
1-complete overhaul reco 2-all H+C lock releases r	ommendeo req comple	d due to age and corrosion (6809	9 TVC 200	3)			
1-complete overhaul reco 2-all H+C lock releases r 3-car oil pots sbrn squar	ommendeo req comple re type	d due to age and corrosion (6809	9 TVC 200	3)			
1-complete overhaul reco 2-all H+C lock releases r 3-car oil pots sbrn squar 4-b/w oil pots sbrn squar	ommendeo req comple re type re type	d due to age and corrosion (6809 etely overhauling) TVC 200	3)			
2-all H+C lock releases i 3-car oil pots sbrn squar 4-b/w oil pots sbrn squar 5-bottom right b/w shoe	ommendeo req comple re type re type	d due to age and corrosion (6809 etely overhauling	9 TVC 200	3)			
1-complete overhaul reco 2-all H+C lock releases r 3-car oil pots sbrn squar 4-b/w oil pots sbrn squar 5-bottom right b/w shoe 6-car top light damaged	ommendeo req comple re type re type liner missi	d due to age and corrosion (6809 etely overhauling	9 TVC 200	3)			
1-complete overhaul reco 2-all H+C lock releases r 3-car oil pots sbrn squar 4-b/w oil pots sbrn squar 5-bottom right b/w shoe 6-car top light damaged 7-car indicator inoperativ	ommendeo req comple re type re type liner missi ve	d due to age and corrosion (6809 etely overhauling ng and sbrn	9 TVC 200	3)			
1-complete overhaul reco 2-all H+C lock releases in 3-car oil pots sbrn squar 4-b/w oil pots sbrn squar 5-bottom right b/w shoe 6-car top light damaged 7-car indicator inoperativ 8-grd floor tiling next to p	ommended req comple re type re type liner missi ve push plate	d due to age and corrosion (6809 etely overhauling ng and sbrn vandalised (B+D to repair)	9 TVC 200	3)			
1-complete overhaul reco 2-all H+C lock releases in 3-car oil pots sbrn squar 4-b/w oil pots sbrn squar 5-bottom right b/w shoe 6-car top light damaged 7-car indicator inoperativ 8-grd floor tiling next to p 9-zone locking inoperativ	ommendee req comple re type re type liner missi ve oush plate ve,parts m	d due to age and corrosion (6809 etely overhauling ng and sbrn vandalised (B+D to repair)	9 TVC 200	3)			
1-complete overhaul reco 2-all H+C lock releases in 3-car oil pots sbrn squar 4-b/w oil pots sbrn squar 5-bottom right b/w shoe 6-car top light damaged 7-car indicator inoperativ 8-grd floor tiling next to p 9-zone locking inoperation 10-under car steel work	ommended req comple re type liner missi ve oush plate ve,parts m corroded	d due to age and corrosion (6809 etely overhauling ng and sbrn vandalised (B+D to repair)	9 TVC 200	3)			
1-complete overhaul reco 2-all H+C lock releases of 3-car oil pots sbrn squar 4-b/w oil pots sbrn squar 5-bottom right b/w shoe 6-car top light damaged 7-car indicator inoperativ 8-grd floor tiling next to p 9-zone locking inoperation 10-under car steel work 11-shaft steel work corror	ommended req comple re type liner missi ve oush plate ve,parts m corroded oded	d due to age and corrosion (6809 etely overhauling ng and sbrn vandalised (B+D to repair) issing	9 TVC 200	3)			
1-complete overhaul reco 2-all H+C lock releases of 3-car oil pots sbrn squar 4-b/w oil pots sbrn squar 5-bottom right b/w shoe 6-car top light damaged 7-car indicator inoperativ 8-grd floor tiling next to p 9-zone locking inoperativ 10-under car steel work 11-shaft steel work corror 12-h/w system req's corr	ommended req comple re type liner missi ve push plate ve,parts m corroded oded nplete over	d due to age and corrosion (6809 etely overhauling ng and sbrn vandalised (B+D to repair) issing	9 TVC 200	3)			
1-complete overhaul reco 2-all H+C lock releases of 3-car oil pots sbrn squar 4-b/w oil pots sbrn squar 5-bottom right b/w shoe 6-car top light damaged 7-car indicator inoperativ 8-grd floor tiling next to p 9-zone locking inoperativ 10-under car steel work 11-shaft steel work corror 12-h/w system req's corro 13-aluminium pit ladder	ommended req comple re type liner missi ve push plate ve,parts m corroded oded nplete over and chain	d due to age and corrosion (6809 etely overhauling ng and sbrn vandalised (B+D to repair) issing	9 TVC 200	3)			
1-complete overhaul reco 2-all H+C lock releases of 3-car oil pots sbrn squar 4-b/w oil pots sbrn squar 5-bottom right b/w shoe 6-car top light damaged 7-car indicator inoperativ 8-grd floor tiling next to p 9-zone locking inoperativ 10-under car steel work 11-shaft steel work corror 12-h/w system req's corro 13-aluminium pit ladder 14-grd floor pit toe guard	ommended req comple re type liner missi ve oush plate ve,parts m corroded oded nplete over and chain d missing	d due to age and corrosion (6809 etely overhauling ng and sbrn vandalised (B+D to repair) issing rhaul damaged	9 TVC 200	3)			
1-complete overhaul reco 2-all H+C lock releases of 3-car oil pots sbrn squar 4-b/w oil pots sbrn squar 5-bottom right b/w shoe 6-car top light damaged 7-car indicator inoperativ 8-grd floor tiling next to p 9-zone locking inoperativ 10-under car steel work 11-shaft steel work corror 12-h/w system req's corro 13-aluminium pit ladder 14-grd floor pit toe guard 15-most landing indicato	ommended req comple re type liner missi ve oush plate ve,parts m corroded oded nplete over and chain d missing	d due to age and corrosion (6809 etely overhauling ng and sbrn vandalised (B+D to repair) issing rhaul damaged	9 TVC 200	3)			
1-complete overhaul rec 2-all H+C lock releases of 3-car oil pots sbrn squar 5-bottom right b/w shoe 6-car top light damaged 7-car indicator inoperativ 8-grd floor tiling next to p 9-zone locking inoperativ 10-under car steel work 11-shaft steel work corro 12-h/w system req's corro 13-aluminium pit ladder 14-grd floor pit toe guard 15-most landing indicato 16-x4 drip trays sbrn	ommended req comple re type liner missi ve oush plate ve,parts m corroded oded nplete over and chain d missing	d due to age and corrosion (6809 etely overhauling ng and sbrn vandalised (B+D to repair) issing rhaul damaged	9 TVC 200	3)			
1-complete overhaul reco 2-all H+C lock releases of 3-car oil pots sbrn squar 5-bottom right b/w shoe 6-car top light damaged 7-car indicator inoperativ 8-grd floor tiling next to p 9-zone locking inoperativ 10-under car steel work 11-shaft steel work corro 12-h/w system req's corro 13-aluminium pit ladder 14-grd floor pit toe guard 15-most landing indicato 16-x4 drip trays sbrn 17-pit buffers corroded	ommended req comple- re type liner missi ve oush plate ve,parts m corroded oded nplete over and chain d missing ors vandalis	d due to age and corrosion (6809 etely overhauling ng and sbrn vandalised (B+D to repair) issing rhaul damaged	9 TVC 200	3)			
1-complete overhaul reco 2-all H+C lock releases of 3-car oil pots sbrn squar 5-bottom right b/w shoe 6-car top light damaged 7-car indicator inoperativ 8-grd floor tiling next to p 9-zone locking inoperativ 10-under car steel work 11-shaft steel work corro 12-h/w system req's corro 13-aluminium pit ladder 14-grd floor pit toe guard 15-most landing indicato 16-x4 drip trays sbrn 17-pit buffers corroded 18- all pit steel work corro	ommended req comple- re type liner missi ve oush plate ve,parts m corroded oded nplete over and chain d missing ors vandalis	d due to age and corrosion (6809 etely overhauling ng and sbrn vandalised (B+D to repair) issing rhaul damaged sed or inoperative	9 TVC 200	3)			
1-complete overhaul rec 2-all H+C lock releases of 3-car oil pots sbrn squar 5-bottom right b/w shoe 6-car top light damaged 7-car indicator inoperativ 8-grd floor tiling next to p 9-zone locking inoperativ 10-under car steel work 11-shaft steel work corro 12-h/w system req's corro 13-aluminium pit ladder 14-grd floor pit toe guard 15-most landing indicato 16-x4 drip trays sbrn 17-pit buffers corroded	ommended req comple- re type liner missi ve oush plate ve,parts m corroded oded nplete over and chain d missing ors vandalis	d due to age and corrosion (6809 etely overhauling ng and sbrn vandalised (B+D to repair) issing rhaul damaged sed or inoperative	9 TVC 200	3)			
1-complete overhaul reco 2-all H+C lock releases of 3-car oil pots sbrn squar 5-bottom right b/w shoe 6-car top light damaged 7-car indicator inoperativ 8-grd floor tiling next to p 9-zone locking inoperativ 10-under car steel work 11-shaft steel work corro 12-h/w system req's corro 13-aluminium pit ladder 14-grd floor pit toe guard 15-most landing indicato 16-x4 drip trays sbrn 17-pit buffers corroded 18- all pit steel work corro 19-governor weight footi	ommended req comple- re type liner missi ve bush plate ve,parts m corroded oded nplete over and chain d missing ors vandalis	d due to age and corrosion (6809 etely overhauling ng and sbrn vandalised (B+D to repair) issing rhaul damaged sed or inoperative	9 TVC 200	3)			

Recommendations

1-panel change recommended due to age

2-door gear upgrade recommended due to age

3-pit to be de-greased and painted4- car top control upgrade recommended

5-main machine sbrn due to age and wear

Powered by Motivity Mobile Workforce Software | www.motivitymobile.com